Lot 34, Discover Marong Marong

Site Classification for Arbor Estates

Report 17C 0575, Lot 34 September, 2017





Lot 34, Discover Marong, Marong

Site Classification for Arbor Estates

Revision

Revision	Date	Authorised	
17C 0575, Lot 34	8/9/17	SEH	

Distribution (this revision only)

Recipient	Format	Date
GTSS	On file	8/9/17
Arbor Estates Attn: Darren Pitson	Email PDF <u>darren@kpdgroup.com.au</u>	8/9/17

Sandhurst Geotech Pty Ltd, Trading as Geotechnical Testing Services - Southern. ABN: 18 169 924 109 ACN: 169 924 109

Email: info@geotestsouthern.com.au; Ph: 03 5441 4881; Fax: 03 5441 5089; Mail Address: PO Box 13, STRATHDALE, Vic, 3550 Offices: • La Trobe University Applied Science 2 Building 7 Sharon Street, Flora Hill, VIC 3550; • Shed 3, 140 Ogilvie Avenue, Echuca , VIC 3654,

Geotechnical Investigations
Contract Drilling
Land Capability Assessments
Contamination Assessments
Compaction Control Testing
On-site Wastewater
Management
Site Classifications
Residential and Industrial
Soil, Concrete and Aggregate Testing Laboratories
Site Laboratory
Construction Material Testing Services
www.geotestsouthern.com.au

1 INTRODUCTION

Arbor Estates commissioned Geotechnical Testing Services to conduct a geotechnical investigation for the proposed residential development located at Lot 34, Discover Marong, Marong.

The investigation has been conducted for the purpose of assessing general subsurface conditions at the site and consequently assigning a Site Classification in accordance with AS2870 – 2011 "Residential Slabs and Footings".

2 INVESTIGATION

The investigation was conducted by a technician on the 6th day of September, 2017 using a trailer mounted drill-rig and drilling 2 boreholes to depths of 1.5 to 3.0 metres within the designated area. The subsequent soil profiles are presented in page 6 and the location of the boreholes are presented on page 7.

At the time of this investigation, the type of development proposed is unknown to GTS.

3 SITE CONDITIONS

The site has been filled (supervised and tested by GTS) to form a relatively flat surface and is currently vacant. At the time of the investigation the surface of the site was moist with no grass cover. There are no trees present in the near vicinity. There was no visual evidence of surface cracking or surface rock. No groundwater seepage was encountered over the investigated depths.

Full details of soil conditions are presented in the borehole logs.

4 SITE CLASSIFICATION

After allowing due consideration to the site geology, soil conditions, the controlled fill (GTS report 17C 0622), drainage and known details of the proposed structure, the site has been classified as **Class H1-D** (AS2870 – 2011).

Foundations designed in accordance with this classification are to be subject to the overriding conditions of Section 5 below.

5 DISCUSSION

Particular attention should be paid to the design of footings as required by AS2870 – 2011.

In addition to the normal founding requirements arising from the above classification, particular conditions at the site dictate that the founding medium and minimum depth below existing surface levels for all footings should be as follows:

 Controlled FILL: Silty CLAY, some gravel, low to medium plasticity, yellow/brown, brown, pale brown, very stiff At depths below 0.05 metres

An allowable bearing pressure of 100kPa is available for edge beams, strips and stump footings founded as above. All foundations should extend a minimum of 100mm into the above founding material.

The proposed dwelling should be located a minimum distance of 1 x the mature height of all trees. This distance can be increased by 50% for groups or lines of trees. If this distance is impeded then the size and distance from the dwelling of the tree(s) needs to be taken into account when designing the foundation.

6 IMPORTANT NOTES ABOUT THIS REPORT

• The site classification presented in Section 4 assumes that the current natural drainage and infiltration conditions at the site will not be markedly affected by the proposed site development work. Care should therefore be taken to ensure that surface water is not permitted to collect adjacent to the structure and that significant changes to seasonal soil moisture equilibria do not develop as a result of service trench construction or tree root action.

• Attention is drawn to Appendix B of AS 2870 and CSIRO document, BTF 18 – "Foundation Maintenance and Footing Performance: A Homeowner's Guide" as a guide to maintenance requirement for the proposed structure.

• This is not a comprehensive investigation nor is it economic or practical to determine every subsurface feature on the site. Although this investigation indicates that soil conditions are relatively uniform across the site, it is recommended that the base of all footing excavations be inspected to ensure that the founding medium meets that requirements referenced herein with respect to type and strength of founding materials. If further variations in descriptions in soil types, colour or depths are discovered during construction, this office should be notified immediately so that potential influence on the footings may be assessed.

• The soil colours provided in the borelogs attached may vary with soil moisture content and individual interpretation, therefore colour alone should not be used to identify these soils.

• Strength characteristics of soils often exhibit a large variation between wet and dry conditions. Soil characteristics of a soil profile are given on the soil conditions at the time of the investigation.

• In the event of significant earthworks being undertaken on the site after this investigation, this report may require an amendment if appropriate.

Should you have any further queries concerning these results, please do not hesitate in contacting this office on 5441 4881

Hungto

Shane Hampton BE (Hons) Senior Geotechnical Engineer

Enclosed Borehole Logs (Page 6) Site Map (Page 7)




Borehole Logs

Client:		Borehole Log No.:	BH
	Arbor Estates	Report Number:	17C 0575, Lot 34
		Date Drilled:	6/9/17
Project:	Lot 34, Discover Marong,	Logged By:	TP
	Marong	Drilling Method	AS

Profile (mm):	* Structure: (see key)	Material Description:	Moisture Description:	Cohesion Density:	Plasticity:	Testing / Sampling:
0		BH1				
То	Fill	(Sandy) SILT	М	M/D	-	
50		Dark brown				
То	Controlled	Silty CLAY	М	St	Low	
300	fill	Yellow brown	IVI	51	Low	
То		Silty CLAY				
1700		Red brown, pale brown, some fine	М	VSt	High	
		gravel				
То	Soil	Silty CLAY	М	VSt	High	
2500	Profile	Pale brown	101	VOI	riigii	
То		(Gravelly, sandy) CLAY				
3000		Pale brown, some fine to medium	М	VSt	Low	
		gravel				
0		BH2				
То	Fill	(Sandy) SILT	M	M/D	-	
50		Dark brown				
То	Controlled	Silty CLAY				
750	fill	Brown, pale brown, some gravel and	М	VSt	Medium	
		sand				
То	Soil	Silty CLAY	м	VSt	High	
1500	Profile	Some fine gravel	101	•00	, iigii	

Key:

Drilling Method:	Moisture Condition	Cohesion:	Density:	Testing/Sampling:
AS - Auger Screwing	D - Dry	VS - Very Soft	VL - Very Loose	PP – Pocket Penetrometer
HA - Hand Auger	M - Moist	S - Soft	L - Loose	V – Hand Vane Sheer
	W - Wet	F - Firm	MD - Medium Dense	DCP – Dynamic Cone Penetrometer
		ST - Stiff	D - Dense	SPT – Standard Penetration Test
		VST - Very Stiff	VD - Very Dense	US – Undisturbed Sampling
		H - Hard		DS – Disturbed Sampling
		VH – Very hard		* See notes on borelog location page

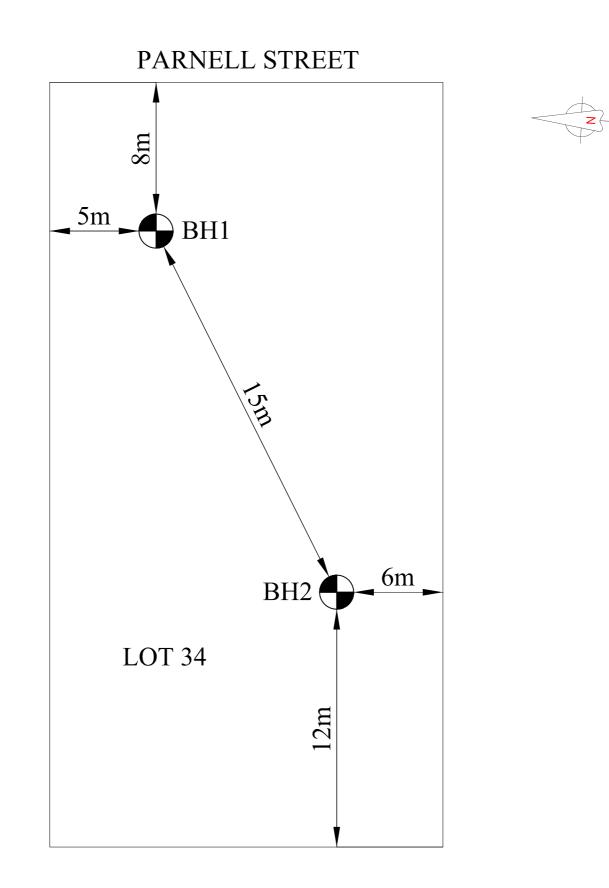

	CLIENT: ARBOR ESTATES PROJECT: LOT 34, DISCOVER MARONG, STAGE 2, MARONG		
APPROXIMATE LOCATIONS NOT TO SCALE	GTS REF: 17C 0575, LOT 34	DATE: 8 SEPTEMBER 2017	