# Discover Marong Stage 6 - Lot 168 Marong

Geotechnical Investigation for Arbor Estates

> Report 19C 0848 (Lot 168) October 2019





# Discover Marong Stage 6 - Lot 168 Marong

## Geotechnical Investigation for Arbor Estates

#### Revision

Revision	Date	Authorised
19C 0848 (Lot 168)	18/10/19	BAB

#### **Distribution (this version only)**

Recipient	Format	Date
GTS	On file	18/10/19
Arbor Estates	Email PDF	18/10/19

#### GEOTECHNICAL | ENVIRONMENTAL | CONSTRUCTION MATERIALS TESTING

PO Box 13, Strathdale VIC 3550 Fax 03 5441 5089 Email info@gts.com.au

Bendigo Laboratory Gate 7, Sharon St, Flora Hill VIC 3550 Phone 03 5441 4881

## Echuca Laboratory

Shed 3, 140 Ogilvie Ave, Echuca VIC 3565 Phone 03 5480 0601

**Ballarat Laboratory** Unit 6, 33 Laidlaw Dr, Delacombe VIC 3356 Phone 03 5335 6494





#### **1 INTRODUCTION**

Arbor Estates commissioned Geotechnical Testing Services (GTS) to conduct a geotechnical investigation for the proposed development at Lot 168, Discover Marong Stage 6, Marong.

The investigation has been conducted for the purpose of assessing general subsurface conditions at the site and consequently assigning a Site Classification in accordance with *AS2870 – 2011 Residential Slabs and Footings*.

#### 2 INVESTIGATION

The investigation was conducted on the 15<sup>th</sup> October 2019 using a trailer mounted drill rig to drill 2 boreholes to depths of 1.5 to 3.0 metres within the designated area. The subsequent soil profiles are presented on page 4 and the location of the boreholes is presented on page 5.

At the time of this investigation, the type of development proposed is understood by GTS to be a new residential building. If the actual construction varies from this then changes may be necessary to this classification report.

#### **3 SITE CONDITIONS**

The site has been developed to form a relatively flat surface and is currently vacant. At the time of the investigation, the surface of the site was dry with no grass cover. There were no trees near the site. There was no visual evidence of surface rock or surface cracking. No groundwater seepage was encountered over the investigated depths.

Full details of the soil conditions are presented in the borehole logs.

#### **4** SITE CLASSIFICATION

After allowing due consideration to the site geology, soil conditions, drainage, vegetation and known details of the proposed structure, the site has been classified as **Class M-D** (*AS2870 – 2011*).

Foundations designed in accordance with this classification are to be subject to the overriding conditions of Section 5 below.



#### 5 DISCUSSION

Particular attention should be paid to the design of footings as required by AS2870 – 2011.

In addition to the normal founding requirements arising from the above classification, particular conditions at the site dictate that the founding medium and minimum depth below existing surface levels for all footings should be as follows:

• Silty CLAY, medium plasticity, brown, orange brown, very stiff At depth below 0.2 metres in the region of BH1 & BH2

An allowable bearing pressure of 100kPa is available for edge beams, strips and stump footings founded as above. All foundations should extend a minimum of 100mm into the above foundation material.

The proposed development should be located a minimum distance of 1 x the mature height of all trees. This distance should be increased by 50% for groups or lines of trees. If this distance is impeded, then the size and distance from the development of the tree(s) needs to be taken into account when designing the foundation.

### **6 IMPORTANT NOTES ABOUT THIS REPORT**

- The site classification presented in Section 4 assumes that the current natural drainage and infiltration conditions at the site will not be markedly affected by the proposed site development work. Care should therefore be taken to ensure that surface water is not permitted to collect adjacent to the structure and that significant changes to seasonal soil moisture equilibria do not develop as a result of service trench construction or tree root action.
- Attention is drawn to Appendix B of AS2870 and CSIRO document *BTF 18 Foundation Maintenance and Footing Performance: A Homeowner's Guide* as a guide to maintenance requirement for the proposed structure.
- This is not a comprehensive investigation nor is it economic or practical to determine every subsurface feature on the site. Although this investigation indicates that soil conditions are relatively uniform across the site, it is recommended that the base of all footing excavations be inspected to ensure that the founding medium meets that requirements referenced herein with respect to type and strength of founding materials. If further variations in descriptions in soil types, colour or depths



are discovered during construction, this office should be notified immediately so that potential influence on the footings may be assessed.

- The soil colours provided in the borehole logs attached may vary with soil moisture content and individual interpretation, therefore colour alone should not be used to identify these soils.
- Strength characteristics of soils often exhibit a large variation between wet and dry conditions. Soil characteristics of a soil profile are given on the soil conditions at the time of the investigation.
- In the event of significant earthworks being undertaken on the site after this investigation, this report may require an amendment if appropriate.
- If FILL is found during this investigation, it is an indication of what was found during the investigation and it may vary over the site. It may be in the best interest of the buyer/seller to undertake a more detailed investigation, in this instance.

Should you have any further queries concerning these results, please do not hesitate to contact GTS on 03 5441 4881.

Benj Beatty BA/BSc (Hons), MPA Geotechnical Engineer – Ballarat District Manager




# **BOREHOLE LOGS**

	Arbor Estates	Borehole log no:	1-2
Client:		Banart number	19C 0848
	AIDOI Estates	Report number:	(Lot 168)
		Date drilled:	15/10/19
Durationate	Discover Marong Stage 6 - Lot 168	Logged by:	BT
Project:	Marong	Drilling method:	AS

Profile (mm):	* Structure: (see key)	Material Description:	Moisture Description:	Cohesion Density:	Plasticity:	Testing / Sampling:
0		BH1				
То 200	FILL	Silty CLAY Brown, trace fine gravel	D – M	St	Low – medium	
То 800	Colling of the	Silty CLAY Brown, orange brown	М	VSt	Medium	
То 2600	Soil profile	Silty CLAY Off white, some fine to medium gravel	М	St	Low	
To 3000	Rock	SILTSTONE Extremely weathered, off white, brown				
0		BH2				
То 200	FILL	Silty CLAY Brown, trace fine gravel	D – M	St	Low – medium	
То 600	Colling of the	Silty CLAY Brown, orange brown	М	VSt	Medium	
To 1300	Soil profile	Silty CLAY Off white, some fine to medium gravel	М	St	Low	
To 1500	Rock	SILTSTONE Extremely weathered, off white	D	Soft rock	-	

Key				
Drilling Method	<b>Moisture Condition</b>	Cohesion	Density	Testing/Sampling
AS – auger screwing	D – dry	VS – very soft	VL – vey loose	PP – pocket penetrometer
HA – hand auger	M – moist	S – soft	L – loose	V – hand vane sheer
	W – wet	F – firm	MD – medium dense	DCP – dynamic cone penetrometer
		St – stiff	D – dense	SPT – standard penetration test
		VSt – very stiff	VD – very dense	US – undisturbed sampling
		H – hard		DS – disturbed sampling
		VH – very hard		* see notes on bore location page

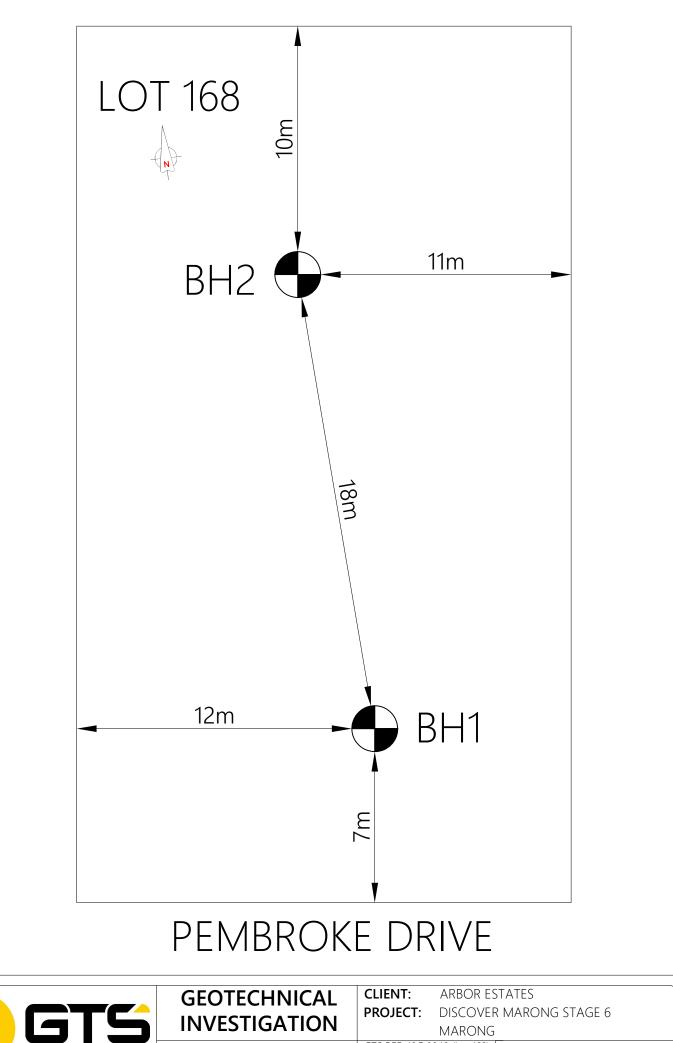

APPROXIMATE LOCATIONS NOT TO SCALE

HNICAL TESTING SERVICE

GTS REF: 19C 0848 (Lot 168) DRAWN BY: BAB CLIENT REF:

DATE: 18 OCTOBER 2019