



**GEOTECHNICAL**  
TESTING SERVICES  
SOUTHERN

# SITE CLASSIFICATION

**Client:** Arbor Estates  
24 Jewell Court  
East Bendigo, Vic 3550

**Date:** 20 August 2015

**Project:** Lot 30 Landsdown Street, Canterbury Estate

## 1 INTRODUCTION

Arbor Estates commissioned Geotechnical Testing Services to conduct a geotechnical investigation for the proposed residential development located at Lot 30 Landsdown Street, Canterbury Estate.

The investigation has been conducted for the purpose of assessing general subsurface conditions at the site and consequently assigning a Site Classification in accordance with AS2870 – 2011 “Residential Slabs and Footings”.

## 2 INVESTIGATION

The investigation was conducted by a technician on the 13<sup>th</sup> of August, 2015 using a vehicle mounted drill-rig and drilling 3 boreholes to depths of 1.5 metres within the designated area. The subsequent soil profiles are presented in page 4 and the location of the boreholes are presented on page 5.

At the time of this investigation, the type of development proposed is unknown to GTS.

## 3 SITE CONDITIONS

The site has been filled over the back half of the lot (supervised and tested by GTS), has a very slight fall to the left and is currently vacant. At the time of the investigation the surface of the site was moist with no grass cover. There are no trees present in the near vicinity. There was no visual evidence of surface cracking.

Groundwater seepage was not encountered over the investigated depths and based on the site location and subsurface profile is highly unlikely to be within 3 metres of the surface at any time.

Full details of soil conditions are presented in the borehole logs.

---

Sandhurst Geotech Pty Ltd, Trading as Geotechnical Testing Services – Southern. ABN: 18 169 924 109 ACN: 169 924 109

Email: [info@geotestsouthern.com.au](mailto:info@geotestsouthern.com.au); Ph: 03 5441 4881; Fax: 03 5441 5089; Mail Address: PO Box 13, STRATHDALE, Vic, 3550  
Offices: • La Trobe University Applied Science 2 Building 7 Sharon Street, Flora Hill, VIC 3550; • Shed 3, 140 Ogilvie Avenue, Echuca, VIC 3654,

• Geotechnical Investigations • Contract Drilling • Land Capability Assessments • Contamination Assessments • Compaction Control Testing • On-site Wastewater Management • Site Classifications • Residential and Industrial • Soil, Concrete and Aggregate Testing Laboratories • Site Laboratory • Construction Material Testing Services • [www.geotestsouthern.com.au](http://www.geotestsouthern.com.au)



**GEOTECHNICAL**  
TESTING SERVICES  
SOUTHERN

#### **4 SITE CLASSIFICATION**

After allowing due consideration to the site geology, controlled fill (GTS report 15C 0216) soil conditions, drainage and known details of the proposed structure, the site has been classified as **Class M-D** (AS2870 – 2011).

Foundations designed in accordance with this classification are to be subject to the overriding conditions of Section 5 below.

#### **5 DISCUSSION**

Particular attention should be paid to the design of footings as required by AS2870 – 2011.

In addition to the normal founding requirements arising from the above classification, particular conditions at the site dictate that the founding medium and minimum depth below existing surface levels for all footings should be as follows:

- Controlled FILL: Gravelly Sandy CLAY, medium plasticity, red/brown, very stiff  
At depths below 0.1m in region of BH1 or
- Silty CLAY, medium plasticity, orange/brown, very stiff  
At depths below 0.1m in the region of BH2

An allowable bearing pressure of 100kPa is available for edge beams, strips and stump footings founded as above. All foundations should extend a minimum of 100mm into the above founding material.

The proposed dwelling should be located a minimum distance of 1 x the mature height of all trees. This distance can be increased by 50 % for groups or lines of trees. If this distance is impeded then the size and distance from the dwelling of the tree(s) needs to be taken into account when designing the foundation.

#### **6 IMPORTANT NOTES ABOUT THIS REPORT**

- The site classification presented in Section 4 assumes that the current natural drainage and infiltration conditions at the site will not be markedly affected by the proposed site development work. Care should therefore be taken to ensure that surface water is not permitted to collect adjacent to the structure and that significant changes to seasonal soil moisture equilibria do not develop as a result of service trench construction or tree root action.



**G E O T E C H N I C A L**  
TESTING SERVICES  
SOUTHERN

- Attention is drawn to Appendix B of AS 2870 and CSIRO document, BTF 18 – “Foundation Maintenance and Footing Performance: A Homeowner’s Guide” as a guide to maintenance requirement for the proposed structure.
- This is not a comprehensive investigation nor is it economic or practical to determine every subsurface feature on the site. Although this investigation indicates that soil conditions are relatively uniform across the site, it is recommended that the base of all footing excavations be inspected to ensure that the founding medium meets that requirements referenced herein with respect to type and strength of founding materials. If further variations in descriptions in soil types, colour or depths are discovered during construction, this office should be notified immediately so that potential influence on the footings may be assessed.
- The soil colours provided in the borelogs attached may vary with soil moisture content and individual interpretation, therefore colour alone should not be used to identify these soils.
- Strength characteristics of soils often exhibit a large variation between wet and dry conditions. Soil characteristics of a soil profile are given on the soil conditions at the time of the investigation.
- In the event of significant earthworks being undertaken on the site after this investigation, this report may require an amendment if appropriate.

Should you have any further queries concerning these results, please do not hesitate in contacting this office on 5441 4881

Yours faithfully

Shane Hampton BE (Hons)  
Senior Geotechnical Engineer

Enclosed

Borelogs (Page 4)

Brief Site Map (Page 5)



**GEOTECHNICAL**  
TESTING SERVICES  
SOUTHERN

**Borehole Logs**

Client:	Arbor Estates	Borehole Log No.:	1 - 2
		Report Number:	15C 0668
		Date Drilled:	13/8/15
Project:	Lot 30 Landsdown Street, Canterbury Estate	Logged By:	ML
		Drilling Method	AS

Profile (mm):	* Structure: (see key)	Material Description:	Moisture Description:	Cohesion Density:	Plasticity:	Testing / Sampling:
0 to 100 to 300 to 900 to 1300 to 1500	Fill	BH1 Sandy SILT Brown	M/D	S	-	
	Controlled Fill	Gravelly Sandy CLAY Red/brown	M	VST	Medium	
	Soil Profile	Silty CLAY Orange/brown, trace of fine to medium gravel	M	VST	Medium	
	SP/Rock	SILTSTONE/Clay Seam Extremely weathered	M	VST/ Soft Rock	Medium	
	Rock	SILTSTONE Extremely weathered, yellow/white	M	Soft Rock	-	
0 to 100 to 800 to 1500	Fill	BH2 Sandy SILT Brown	M/D	S	-	
	Soil Profile	Silty CLAY Orange/brown	M	VST	Medium	
	Rock	SILTSTONE Extremely weathered, white	M	Soft Rock	-	


Key:

Drilling Method:	Moisture Condition	Cohesion:	Density:	Testing/Sampling:
AS - Auger Screwing	D - Dry	VS - Very Soft	VL - Very Loose	PP – Pocket Penetrometer
HA - Hand Auger	M - Moist	S - Soft	L - Loose	V – Hand Vane Shear
	W - Wet	F - Firm	MD - Medium Dense	DCP – Dynamic Cone Penetrometer
		ST - Stiff	D - Dense	SPT – Standard Penetration Test
		VST - Very Stiff	VD - Very Dense	US – Undisturbed Sampling
		H - Hard		DS – Disturbed Sampling
		VH – Very hard		* See notes on borelog location page

## Borehole Locations

Client :	ARBOR ESTATES
Project:	LOT 30 LANCASTER DRIVE CANTERBURY ESTATE

Borehole No. :	1 - 2
Report No. :	15C 0668
Date Drilled :	13/8/15
Operator:	ML
Drilling Method:	A.S
Page No.:	5 of 5

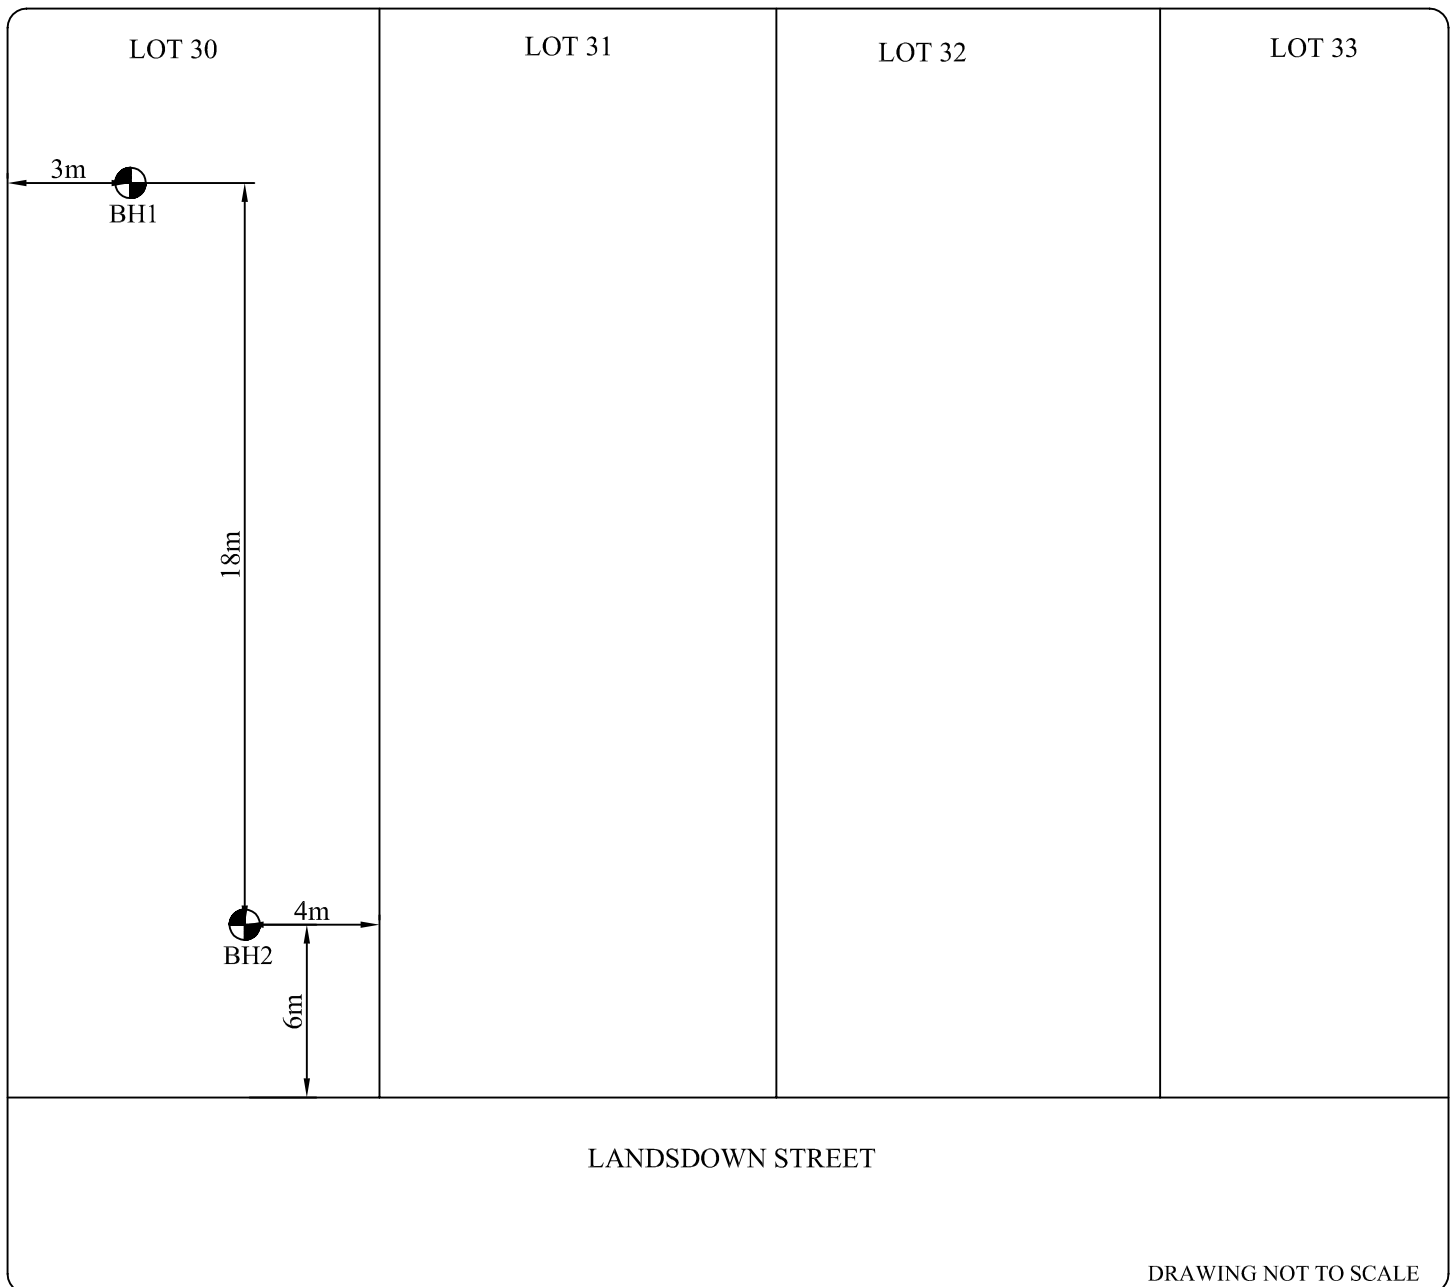

DRAWING NOT TO SCALE

(T) = TREES