# Lot 122 – Discover Marong Stage 5 Marong

Geotechnical Investigation for Arbor Estates

Report 19C 0356 (Lot 122) June 2019





## Lot 122 – Discover Marong Stage 5 Marong

### Geotechnical Investigation for **Arbor Estates**

#### **Revision**

Revision	Date	Authorised
19C 0356 (Lot 122)	27/06/2019	BAB

#### **Distribution (this version only)**

Recipient	Format	Date	
GTS	On file	27/06/2019	
Arbor Estates	Email PDF	27/06/2019	



Phone 03 5441 4881



#### 1 INTRODUCTION

Arbor Estates commissioned Geotechnical Testing Services (GTS) to conduct a geotechnical investigation for the proposed residential development at the Lot 122 – Discover Marong Stage 5, Marong.

The investigation has been conducted for the purpose of assessing general subsurface conditions at the site and consequently assigning a Site Classification in accordance with AS2870 – 2011 Residential Slabs and Footings.

#### 2 INVESTIGATION

The investigation was conducted on the 25<sup>th</sup> June 2019 using a vehicle mounted drill-rig and drilling 2 boreholes to depths of 1.5 to 3.0 metres within the designated area. The subsequent soil profiles are presented on page 4 and the location of the boreholes is presented on page 5.

At the time of this investigation, the type of development proposed was unknown to GTS.

#### 3 SITE CONDITIONS

The site has been developed to form the current surface level and is vacant. At the time of the investigation, the surface of the site was dry with no grass cover. There were no trees in the immediate vicinity. There was no visual evidence of surface rock or surface cracking. No groundwater seepage was encountered over the investigated depths.

Full details of the soil conditions are presented in the borehole logs.

#### 4 SITE CLASSIFICATION

After allowing due consideration to the site geology, soil conditions, drainage, vegetation and known details of the proposed structure, the site has been classified as **Class H1-D** (AS2870 - 2011).

Foundations designed in accordance with this classification are to be subject to the overriding conditions of Section 5 below.



#### 5 DISCUSSION

Particular attention should be paid to the design of footings as required by AS2870 – 2011.

In addition to the normal founding requirements arising from the above classification, particular conditions at the site dictate that the founding medium and minimum depth below existing surface levels for all footings should be as follows:

 (Sandy) Silty CLAY, high plasticity, brown, dark brown, very stiff
At varying depths below 0.0 metres in the region of BH1 and depths below 0.1m in the region of BH2

An allowable bearing pressure of 100kPa is available for edge beams, strips and stump footings founded as above. All foundations should extend a minimum of 100mm into the above foundation material.

The proposed development should be located a minimum distance of 1 x the mature height of all trees. This distance should be increased by 50% for groups or lines of trees. If this distance is impeded, then the size and distance from the development of the tree(s) needs to be taken into account when designing the foundation.

#### **6 IMPORTANT NOTES ABOUT THIS REPORT**

- The site classification presented in Section 4 assumes that the current natural drainage and infiltration conditions at the site will not be markedly affected by the proposed site development work. Care should therefore be taken to ensure that surface water is not permitted to collect adjacent to the structure and that significant changes to seasonal soil moisture equilibria do not develop as a result of service trench construction or tree root action.
- Attention is drawn to Appendix B of AS2870 and CSIRO document *BTF 18 Foundation Maintenance and Footing Performance: A Homeowner's Guide* as a guide to maintenance requirement for the proposed structure.
- This is not a comprehensive investigation nor is it economic or practical to determine every subsurface feature on the site. Although this investigation indicates that soil conditions are relatively uniform across the site, it is recommended that the base of all footing excavations be inspected to ensure that the founding medium meets that requirements referenced herein with respect to type and strength of founding materials. If further variations in descriptions in soil types, colour or depths



are discovered during construction, this office should be notified immediately so that potential influence on the footings may be assessed.

- The soil colours provided in the borehole logs attached may vary with soil moisture content and individual interpretation, therefore colour alone should not be used to identify these soils.
- Strength characteristics of soils often exhibit a large variation between wet and dry conditions. Soil characteristics of a soil profile are given on the soil conditions at the time of the investigation.
- In the event of significant earthworks being undertaken on the site after this investigation, this report may require an amendment if appropriate.
- If FILL is found during this investigation, it is an indication of what was found during the investigation and it may vary over the site. It may be in the best interest of the buyer/seller to undertake a more detailed investigation, in this instance.

Should you have any further queries concerning these results, please do not hesitate to contact GTS on 03 5441 4881.

Benj Beatty BA/BSc (Hons), MPA

Geotechnical Engineer - Ballarat District Manager




## **BOREHOLE LOGS**

	Arbor Estates	Borehole log no:	1-2
Client:		Report number:	19C 0356
			(Lot 122)
		Date drilled:	25/06/19
D	Lot 122 – Discover Marong Stage 5	Logged by:	RC
Project:	Marong	Drilling method:	AS

Profile (mm):	* Structure: (see key)	Material Description:	Moisture Description:	Cohesion Density:	Plasticity:	Testing / Sampling:
0		BH1				
То		Sandy Silty CLAY	M	\/C+	Lliab	
600		Dark brown, brown	IVI	VSt	High	
То	_ Soil profile	Silty CLAY				
To		Pale brown, brown,	М	VSt	High	
3000		traces of fine to medium sand				
0		BH2				
То	FILL	Sandy SILT	М	MD	Low	
100	FILL	Dark brown	IVI	טוט	LOW	
То		Silty CLAY	М	VSt	Lliab	
1100		Brown	IVI	VSL	High	
To 1500	Soil profile	Silty CLAY				_
		Pale brown, brown,	М	VSt	High	
		traces of fine sand				

### Key

Drilling Method	<b>Moisture Condition</b>	Cohesion	Density	Testing/Sampling
AS – auger screwing	D – dry	VS – very soft	VL – vey loose	PP – pocket penetrometer
HA – hand auger	M – moist	S – soft	L – loose	V – hand vane sheer
	W – wet	F – firm	MD – medium dense	DCP – dynamic cone penetrometer
		St – stiff	D – dense	SPT – standard penetration test
		VSt – very stiff	VD – very dense	US – undisturbed sampling
		H – hard		DS – disturbed sampling
		VH – very hard	]	* see notes on bore location page

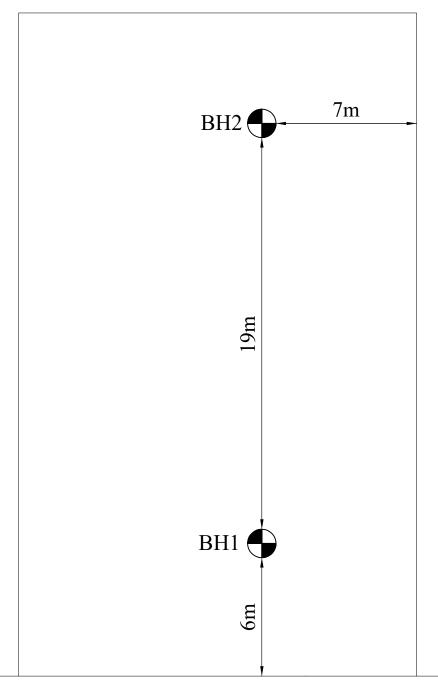

FALLS STREET



**GEOTECHNICAL INVESTIGATION** 

**CLIENT:** ARBOR ESTATES

**PROJECT:** DISCOVER MARONG ESTATE

STAGE 5, MARONG

APPROXIMATE LOCATIONS NOT TO SCALE GTS REF: 19C 0356 (Lot 122)

DATE: 18 JUNE 2019