Lot 19 Bartels Run Stage 1 Jackass Flat

Geotechnical Investigation for Arbor Estates

> Report 24C 0185-19 April 2024





Lot 19 Bartels Run Stage 1 **Jackass Flat**

Geotechnical Investigation for **Arbor Estates**

Revision

| Revision | Authorised | Date |
|-------------|------------|------------|
| 24C 0185-19 | SEH | 26/04/2024 |

Distribution (this version only)

| Recipient | Format | Date |
|--------------------------------------|-------------------------------------|------------|
| GTS | On file | 26/04/2024 |
| Arbor Estates Attn: Darren Pitson | Email PDF darren@kpdgroup.com.au | 26/04/2024 |



GEOTECHNICAL | ENVIRONMENTAL | CONSTRUCTION MATERIALS TESTING

Head Office / Mail 13 Alstonvale Court, East Bendigo VIC 3550 Phone 03 5441 4881

Bendigo Laboratory 13 Alstonvale Court, East Bendigo VIC 3550 Phone 03 5441 4881

Echuca Laboratory Shed 3, 140 Ogilvie Ave, Echuca VIC 3565 Phone 03 5480 0601

Ballarat Laboratory Unit 6, 33 Laidlaw Dr, Delacombe VIC 3356 Phone 03 5303 9993



1 INTRODUCTION

Arbor Estates commissioned Geotechnical Testing Services (GTS) to conduct a geotechnical investigation for the proposed development at Lot 19 Bartels Run Stage 1, Jackass Flat.

The investigation has been conducted for the purpose of assessing general subsurface conditions at the site and consequently assigning a Site Classification in accordance with AS2870 - 2011 *Residential Slabs and Footings*.

2 INVESTIGATION

The investigation was conducted on the 12th of April 2024 using a trailer mounted drill rig to drill 3 boreholes to depths of 1.5 metres within the designated area. The soil profiles and borehole locations are presented at the end of this report.

At the time of this investigation, the type of development proposed is understood by GTS to be a general classification of the lot. If the actual construction varies from this, then changes may be necessary to this classification report.

3 SITE CONDITION

The site has a slight fall to the front and is currently vacant. At the time of the investigation, the surface of the site was dry and lacked grass cover. There are no trees across the lot. There was no visual evidence of surface cracking or surface rock. No groundwater seepage was encountered over the investigated depths.

Full details of the soil conditions are presented in the borehole logs.

4 SITE CLASSIFICATION

After allowing due consideration to the site geology, soil conditions, drainage, vegetation including trees and known details of the proposed development, the site has been classified as **Class S**.

Class S sites have an expected characteristic surface movement (y_s) of 0 to 20mm.

Foundations designed in accordance with this classification are to be subject to the overriding conditions of Section 5.



5 DISCUSSION

Particular attention should be paid to the design of footings as required by AS2870 – 2011.

In addition to the normal founding requirements arising from the above classification, particular conditions at the site dictate that the founding medium and minimum depth below existing surface levels for all footings should be as follows:

 Silty CLAY, medium plasticity, orange/brown, trace fine gravel, trace fine to coarse sand, stiff to very stiff.
 At depth below 0.1 metres in the region of BHs 1 to 3.

Or

• SILTSTONE, distinctly weathered, pale brown, low strength rock. At depth below 0.5 metres in the region of BHs 1 to 3.

An allowable bearing pressure of 100kPa is available for edge beams, strips and stump footings founded in the natural silty clays, and an allowable bearing pressure of 300kPa is available for edge beams, strips and stump footings founded in the weathered siltstone rock. All foundations should extend a minimum of 100mm into the above foundation material.

If founding on the siltstone rock, bored or screw piers may be considered. Blinding concrete (minimum strength 15MPa) may be used to bring the excavations up to design levels.

The base of all footing excavations must be free of tree roots.

6 IMPORTANT NOTES ABOUT THIS REPORT

- The site classification presented in Section 4 assumes that the current natural drainage and infiltration conditions at the site will not be markedly affected by the proposed site development work. Care should therefore be taken to ensure that surface water is not permitted to collect adjacent to the structure and that significant changes to seasonal soil moisture equilibria do not develop as a result of service trench construction or tree root action.
- Attention is drawn to Appendix B of AS2870 and CSIRO document *BTF 18 Foundation Maintenance and Footing Performance: A Homeowner's Guide* as a guide to maintenance requirement for the proposed structure.
- This is not a comprehensive investigation nor is it economic or practical to determine every subsurface feature on the site. Although this investigation indicates that soil conditions are relatively uniform across the site, it is recommended that the base of all footing excavations be inspected to ensure that the founding medium meets the requirements referenced herein with respect to type and strength of founding materials. If further variations in descriptions in soil types, colour or depths are discovered during construction, this office should be notified immediately so that potential influence on the footings may be assessed.



- The soil colours provided in the borehole logs attached may vary with soil moisture content and individual interpretation, therefore colour alone should not be used to identify these soils.
- Strength characteristics of soils often exhibit a large variation between wet and dry conditions. Soil characteristics of a soil profile are given on the soil conditions at the time of the investigation.
- In the event of significant earthworks being undertaken on the site after this investigation, this report may require an amendment if appropriate.
- If FILL is found during this investigation, it is an indication of what was found during the investigation and it may vary over the site. It may be in the best interest of the buyer/seller to undertake a more detailed investigation, in this instance.

Should you have any further queries concerning these results, please do not hesitate to contact GTS on 03 5441 4881.


Prepared by

Reviewed by

Corey Palmer BE (Hons) GradIEAust Graduate Geotechnical Engineer

Hungton

Shane Hampton BE (Hons), MIEAust Principal Geotechnical Engineer

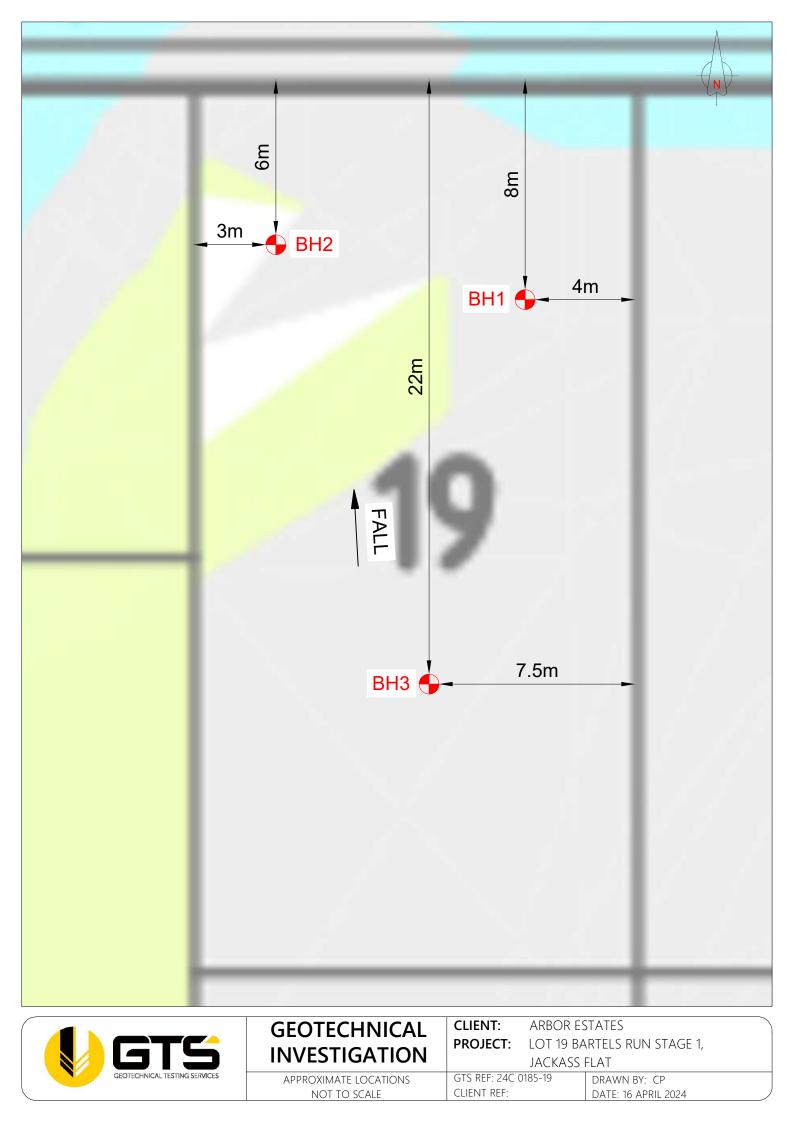



GTS - Bendigo

13 Alstonvale Court East Bendigo VIC 3550 Phone: 03 5441 4881

Geotechnical Log - Borehole

1

| | | | | | Phone: 03 5441 4 | 881 | | | | | | | |
|-------------------|--|-------------------|-------------|--|--|---|-----------|-------------|--|-----|---------------------------|-----|---------|
| Northin Ground | UTM : Easting (m) : 0.00 Northing (m) : 0.00 Ground Elevation : Not Surveyed Total Depth : 1.5 m BGL | | | Drill Rig : Honda SCR - Trailer Mount Driller Supplier : Geotechnical Testing Services Logged By : PB Reviewed By : CP Date : 12/04/2024 | | Clier Proje Loca | it ect | : Lot 19 Ba | bor Estate e Classification t 19 Bartels Run Stage 1, Jackass Flat | | | | |
| Water | Depth (m) | Soil Origin | Graphic Log | Classification Code | | Material Description | Moisture | Weathering | Consistency | DCP | Testing (R A a) A A | SPT | Remarks |
| | 0. <u>1</u> - 0. <u>5</u> - 1 | Fill Natural Rock | | CL | to coarse grained so medium sized grave Silty CLAY (CI) : stit orange brown, with trace fine to coarse | ff to very stiff, medium plasticity, sized gravel, trace fine sized grave grained sand, moist to dry. | / M-D | DW | F St-VSt LS | | | | |
| | - | | | | | L Terminated at 1.5m | | | | | | | |



GTS - Bendigo

13 Alstonvale Court East Bendigo VIC 3550 Phone: 03 5441 4881

Geotechnical Log - Borehole

2

| | | | | | Phone: 03 5441 4 | 381 | | | | 2 | | | | |
|--|------------------|---|-------------|---------------------|---|---|-------|-----------------------------|------------|-------------|--------------------|--------------|----------|---------|
| UTM Eastin Northin Groun Total D | ng (m) d Elev | : : 0.0 : 0.0 ation : Not : 1.5 | 0 t Surv | | Drill Rig Driller Supplier Logged By Reviewed By Date | : Honda SCR - Trailer Mount : Geotechnical Testing Services : PB : CP : 12/04/2024 | | Client Projec Locatio | t | | tate sification | tage 1, Jack | ass Flat | |
| | | | | e e | | 5 | | | | | | Testing | | |
| Water | Depth (m) | Soil Origin | Graphic Log | Classification Code | | Material Description | | Moisture | Weathering | Consistency | DCP | PP (kPa) | SPT | Remarks |
| | 0. <u>1</u> | Fill Natural | | CL | to coarse grained s medium sized grave | | ne to | D M-D | | F St-VSt | | | | |
| | - | | | | orange brown, with | f to very stiff, medium plasticity sized gravel, trace fine sized g grained sand, moist to dry. | | | | | | | | |
| | _ 0 <u>5</u> | Rock | | SLT | SILTSTONE: disting brown, grained, dry | tly weathered, low strength, pa | ale | D | DW | LS | | | | |
| | - | | | | ; | ? Terminated at 1.5m | | | | | | | | |



GTS - Bendigo

13 Alstonvale Court East Bendigo VIC 3550 Phone: 03 5441 4881

Geotechnical Log - Borehole

3

| | | | | | Phone: 03 5441 4 | 881 | | | | 3 | | | | |
|---|------------------|---|-------------|---------------------|---|--|-----------------|----------------------------|------------|-------------|--------------------|--------------|----------|---------|
| UTM Eastin Northi Groun Total D | ng (m) d Elev | : : 0.0 : 0.0 ation : Not : 1.5 | 0 : Surv | | Drill Rig Driller Supplier Logged By Reviewed By Date | : Honda SCR - Trailer Mount : Geotechnical Testing Servic : PB : CP : 12/04/2024 | 85 | Client Projec Locati | t | | tate sification | tage 1, Jack | ass Flat | |
| | | | | de | | uoj | | | | | | Testing | | |
| Water | Depth (m) | Soil Origin | Graphic Log | Classification Code | | Material Description | | Moisture | Weathering | Consistency | DCP | PP (kPa) | TqS | Remarks |
| | 0. <u>1</u> | Fill Natural | | CL | | ′ (CL) : low plasticity, bi and, with sized gravel, el, dry. | | D M-D | | F St-VSt | | | | |
| | - | Inatul al | | 5 | orange brown, with | ff to very stiff, medium sized gravel, trace fine grained sand, moist to | e sized gravel, | | | 51-751 | | | | |
| | 0.5 | Rock | | SLT | SILTSTONE: distine brown, grained, dry | ctly weathered, low stre | ength, pale | D | DW | LS | | | | |
| | - 1 | | | | | | | | | | | | | |
| | - | | | | | 3 Terminated at 1.5m | | | | | | | | |



DESCRIPTIVE TERMS BOREHOLE/EXCAVATION LOG

Classification Symbol & Soil Name

Classification of material and its description is based on the Unified Classification System as referenced in AS1726 – 1993 Geotechnical Site Investigations, Appendix A. A summary of the more common terms is included within.

Particle Size Descriptive Terms

| Name | Subdivision | Size |
|----------|-------------|------------------|
| Boulders | | >200mm |
| Cobbles | | 63 – 200mm |
| Gravel | Coarse | 20 – 63mm |
| | Medium | 6 – 20mm |
| | Fine | 2.36 – 6mm |
| Sand | Coarse | 0.6 – 2.36mm |
| | Medium | 200 – 600 micron |
| | Fine | 75 – 200 micron |
| Silt | | 2 – 75 micron |
| Clay | | < 2 micron |

Consistency of Cohesive Soils

| Term | Undrained shear strength, s _u (kPa) | Field Guide |
|---------------------|--|---|
| Very Soft (VS) | <12 | A finger can be pushed well into the soil with little effort |
| Soft (S) | 12 – 25 | A finger can be pushed into the soil to about 25mm depth |
| Firm (F) | 25 – 50 | The soil can be indented about 5mm with the thumb |
| Stiff (St) | 50 – 100 | The surface of the soil can be indented with the thumb |
| Very Stiff (VSt) | 100 – 200 | The surface of the soil can be indented by thumb nail |
| Hard (H) | >200 | The surface of the soil can be marked only with the thumbnail |
| Friable (F) | - | Crumbles or powders when scraped by thumbnail |

Method

| S | Auger Screwing | W | Washboring |
|---|----------------|---|---------------------|
| D | Auger Drilling | N | Natural Exposure |
| R | Roller/tricone | E | Existing Excavation |

Water

| * | Not observed |
|--------|-----------------------------------|
| \leq | Observed water level (date shown) |

- Observed water inflow
- Observed water outflow
- R Refer to report for details

Structures, Additional Observations

| PP | Pocket Penetrometer test (kPa) |
|-----|--------------------------------|
| DCP | Dynamic Cone Penetrometer test |
| | (blows/100mm) |

Density of Granular Soils

| Term | Density Index (%) |
|-------------------|-------------------|
| Very Loose (VL) | < 15 |
| Loose (L) | 15 – 35 |
| Medium Dense (MD) | 35 – 65 |
| Dense (D) | 65 – 85 |
| Very Dense (VD) | > 85 |

Minor Components

| Term | Field Guide | Proportion of Minor Component In: |
|----------|--|---|
| Trace of | Presence just detectable by feel or eye | Coarse grained soils: <5% Fine grained soils: <15% |
| Some | Presence easily detectable by feel or eye | Coarse grained soils: 5-12% Fine grained soils: 15-30% |

Moisture Condition

| Dry (D) | Looks & feels dry. Cohesive soils are usually hard, powdery or friable. Granular soils run freely through the hand. |
|-----------|---|
| Moist (M) | Soil feels cool and darkened in colour. Cohesive |

- soils can be moulded. Granular soils tend to cohere. Free water does not form.
- Wet (W) As for moist, but with free water forming on hands when remoulded.

Support

| в | Blade/bucket | * | Nil |
|---|--------------|---|-------------|
| С | Coring | С | Casing |
| н | Hammer Drill | м | Mud/polymer |

Notes, Samples, Tests

U63 Undisturbed sample, 63mm diameter

D Disturbed sample
 N* Standard Penetration Test, (*) Sample

Figure = results

Surface

| | Known boundary |
|-------------|-------------------|
| | Probably boundary |
| -?-?-?-?-?- | Possible boundary |